
# Test Procedure for the LV8736VGEVB Evaluation Board



# **SANYO Semiconductors**

An ON Semiconductor Company

# **For Stepping Motor Control**

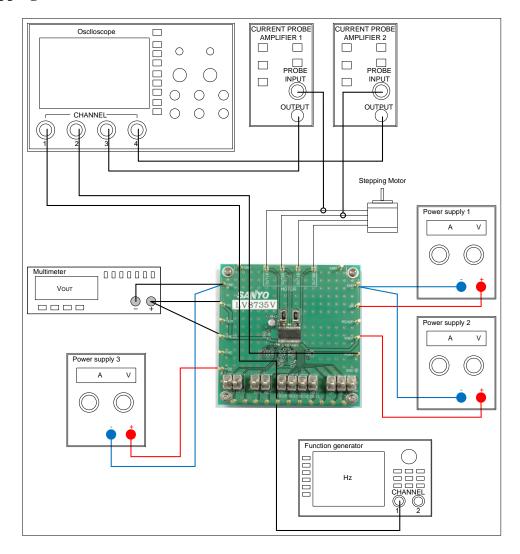

**Table1: Required Equipment** 

Equipment	Efficiency
Power supply1	35V-5A
Power supply2	5V-0.5A
Power supply3	10V-1A
Function generator	200kHz
Multimeter	-
Oscilloscope	4 channel
Current probe1	-
Current probe2	-
LV8736V Evaluation Board	-
Stepping Motor	35V-3A

#### **Test Procedure:**

- 1. Connect the test setup as shown above.
- 2. Set it according to the following specifications.

## **Supply Voltage**

- VM (9 to 32V): Power Supply for LSI
- VREF (0 to 3V): Const. Current Control for Reference Voltage
- VDD (2 to 5V): Logic "High" voltage for toggle switch

## **Toggle Switch State**


- Upper Side: High (VDD)
- Middle: Open, enable to external logic input
- Lower Side: Low (GND)

### **Operations Guide**


- 1. <u>Initial Condition Setting</u>: Set "Open" the toggle switch STEP/D22, and "Open or Low" the other switches.
- 2. **Power Supply:** Supply DC voltage to VM, VREF and VDD.
- 3. **Ready for Operation from Standby State:** Turn "High" the ST terminal toggle switch. Channel 1 and 2 are into 2-phase excitement initial position (100%, -100%).
- 4. Motor Operation: Input the clock signal into the terminal STEP/DC22.
- 5. Other Setting: (See Application Note for detail)
  - i. ATT1, ATT2: Motor current attenuation.
  - ii. EMM: Short circuit protection mode change.
  - iii. RST/BLK: Initial Mode.
  - iv. FR/DC21: Motor rotation direction (CW/CCW) setting.
  - v. MD1/DC11, MD2/DC12: Excitation mode.
  - vi. OE/CMK: Output Enable.
- 3. Check VREG5 and VG terminal voltage at multimeter.
- 4. Check the STEP/DC22 and MONI terminal voltage at scope CH1 and CH2, and the output current waveform at scope CH3 and CH4.

**Table2: Desired Results** 

INPUT	OUTPUT
VM=24V	
VREF=1.5V	
VDD=5V	
ST=High	
DM=Low	VREG5=4.5V to
EMM=Low, RST/BLK=Low,	5.5V
OE/CMK=Low	VG=28V to 29.8V
ATT1=ATT2=Low	
FR/DC21=Low	
MD1/DC11=MD2/DC12=High	
STEP/DC22=500Hz(Duty50%)	

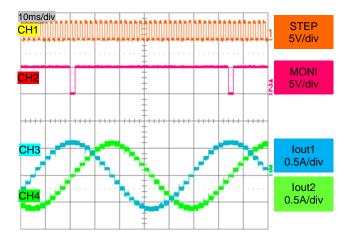

### **For DC Motor Control**

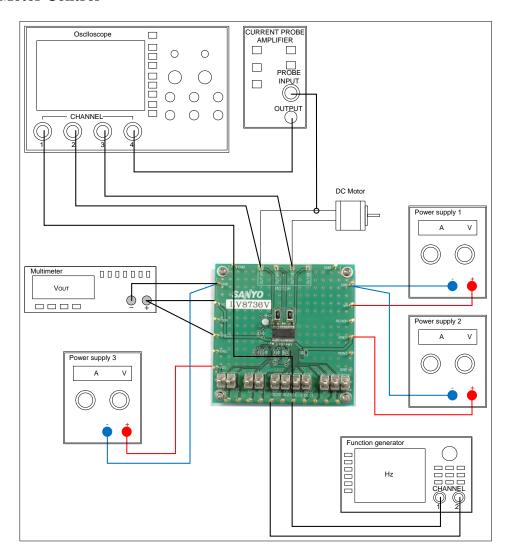

**Table3: Required Equipment** 

Equipment	Efficiency
Power supply1	35V-5A
Power supply2	5V-0.5A
Power supply3	10V-1A
Function generator	200kHz
Multimeter	-
Oscilloscope	4 channel
Current probe	-
LV8736V Evaluation Board	-
DC Motor	35V-3A

#### **Test Procedure:**

- 1. Connect the test setup as shown above.
- 2. Set it according to the following specifications.

# **Supply Voltage**

- VM (9 to 32V): Power Supply for LSI
- VREF (0 to 3V): Const. Current Control for Reference Voltage
- VDD (2 to 5V): Logic "High" voltage for toggle switch

## **Toggle Switch State**

- Upper Side: High (VDD)
- Middle: Open, enable to external logic input
- Lower Side: Low (GND)

### **Operations Guide**

- 1. <u>Initial Condition Setting</u>: Set "Open" the toggle switch DM, and "Open or Low" the other switches.
- 2. **Power Supply:** Supply DC voltage to VM, VREF and VDD.
- 3. **Ready for Operation from Standby State:** Turn "High" the ST terminal toggle switch.
- 4. <u>Motor Operation</u>: Set MD1/DC11, MD2/DC12, FR/DC21, and STEP/DC22 terminals according to the purpose.
- 5. Other Setting: (See Application Note for detail)
  - i. ATT1, ATT2: Motor current attenuation.
  - ii. EMM: Short circuit protection mode change.
  - iii. RST/BLK: Blanking time change.
- 3. Check VREG5 and VG terminal voltage at multimeter.
- 4. Check the MD2/DC12, OUT1A, and OUT1B terminal voltage at scope CH1, CH2, and CH3, and the output current waveform at scope CH4.
- 5. Switch to channel 2(STEP/DC22, OUT2A, OUT2B) as well as channel 1(MD2/DC12, OUT1A, OUT1B) and measure it.

**Table4: Desired Results** 

INPUT	OUTPUT
VM=24V	
VREF=1.5V	
VDD=5V	
ST=High	
DM=High	VREG5=4.5V to
EMM=Low, RST/BLK=Low,	5.5V
OE/CMK=Open	VG=28V to 29.8V
ATT1=ATT2=Low	
FR/DC21=STEP/DC22=Low	
MD1/DC11=High	
MD2/DC12=100kHz(Duty50%)	

